



IGNITION APPLICATION DATA

TCM IGNITION SYSTEMS

Application Data

Engine		Ignition Sytem	Left Magneto		Right Magneto		Gold Seal Harness	
Teledyne Continental	Notes	Kit Part No.	Type	Part No.	Type	Part No.	Spark Plug	Complete Part. No.
A-65, A-75	45	10-400458	S4RSC-21	10-500514-3	S4RSC-204	10-600644-3	5/8-24	10-821471-3
A-65, A-75	45	10-400459	S4RSC-21	10-500514-3	S4RSC-21	10-500514-3	5/8-24	10-821471-3
A-65, A-75	2, 45	-	4300	-	4300	-	5/8-24	10-821401-3
C-75-8	45	10-400458	S4RSC-21	10-500514-3	S4RSC-204	10-600644-3	5/8-24	10-821471-3
C-75-8	45	10-400459	S4RSC-21	10-500514-3	S4RSC-21	10-500514-3	5/8-24	10-821471-3
C-75-8	2, 45	-	4300	-	4300	-	5/8-24	10-821401-3
C-75-12	45	10-400452	S4LSC-21	10-500514-1	S4LSC-21	10-500514-1	5/8-24	10-821471-1
C-75-12	2, 45	-	4300	-	4300	-	5/8-24	10-821401-1
C-75-15	45	10-400452	S4LSC-21	10-500514-1	S4LSC-21	10-500514-1	5/8-24	10-821471-1
C-75-15	2, 45	-	4300	-	4300	-	5/8-24	10-821401-1
C-85-8	45	10-400458	S4RSC-21	10-500514-3	S4RSC-204	10-600644-3	5/8-24	10-821471-3
C-85-8	45	10-400459	S4RSC-21	10-500514-3	S4RSC-21	10-500514-3	5/8-24	10-821471-3
C-85-8	2, 45	-	4300	-	4300	-	5/8-24	10-821401-3
C-85-12	45	10-400452	S4LSC-21	10-500514-1	S4LSC-21	10-500514-1	5/8-24	10-821471-1
C-85-12	2, 45	-	4300	-	4300	-	5/8-24	10-821401-1
C-85-14	45	10-400452	S4LSC-21	10-500514-1	S4LSC-21	10-500514-1	5/8-24	10-821471-1
C-85-14	2, 45	-	4300	-	4300	-	5/8-24	10-821401-1
C-85-15	45	10-400452	S4LSC-21	10-500514-1	S4LSC-21	10-500514-1	5/8-24	10-821471-1
C-85-15	2, 45	-	4300	-	4300	-	5/8-24	10-821401-1
C-90-8	45	10-400459	S4RSC-21	10-500514-3	S4RSC-21	10-500514-3	5/8-24	10-821471-3
C-90-8	2, 45	-	4300	-	4300	-	5/8-24	10-821401-3
C-90-12	45	10-400452	S4LSC-21	10-500514-1	S4LSC-21	10-500514-1	5/8-24	10-821471-1
C-90-12	45	-	S4LSC-200	10-600614-3	S4LSC-204	10-600644-4	5/8-24	10-821471-1
C-90-12	2, 45	-	4300	-	4300	-	5/8-24	10-821401-1
C-90-14	45	10-400452	S4LSC-21	10-500514-1	S4LSC-21	10-500514-1	5/8-24	10-821471-1
C-90-14	45	-	S4LSC-200	10-600614-3	S4LSC-204	10-600644-4	5/8-24	10-821471-1
C-90-14	2, 45	-	4300	-	4300	-	5/8-24	10-821401-1
C-90-16	45	10-400452	S4LSC-21	10-500514-1	S4LSC-21	10-500514-1	5/8-24	10-821471-1
C-90-16	45	-	S4LSC-200	10-600614-3	S4LSC-204	10-600644-4	5/8-24	10-821471-1
C-90-16	2, 45	-	4300	-	4300	-	5/8-24	10-821401-1
C-125-2	-	10-400455	S6LSC-21	10-500516-4	S6LSC-21	10-500516-4	5/8-24	10-821672-9
C-145-2, 2H	-	10-400455	S6LSC-21	10-500516-4	S6LSC-21	10-500516-4	5/8-24	10-821672-9
E-165-2, 3, 4	39	-	S6LSC-21	10-500516-3	S6LSC-21	10-500516-3	5/8-24	10-821672-13
E-165-2, 3, 4	40	-	S6LSC-21	10-500516-10	S6LSC-21	10-500516-10	5/8-24	10-821672-13
E-185-1, 2, 3, 5	39	-	S6LSC-21	10-500516-3	S6LSC-21	10-500516-3	5/8-24	10-821672-13
8, 9, 10, 11	-	-	-	-	-	-	-	-
E-185-1, 2, 3, 5	40	-	S6LSC-21	10-500516-10	S6LSC-21	10-500516-10	5/8-24	10-821672-13
8, 9, 10, 11	-	-	-	-	-	-	-	-
O-200A,B,C	-	10-400452	S4LSC-21	10-500514-1	S4LSC-21	10-500514-1	5/8-24	10-821471-1
O-200A,B,C	-	-	S4LSC-200	10-600614-3	S4LSC-204	10-600644-4	5/8-24	10-821471-1
O-200A,B,C	25	-	S4LH-1227	10-349365-3	S4LH-1227	10-349365-3	5/8-24	-
O-200A,B,C	2	-	4300	-	4300	-	5/8-24	10-821401-1
E-225-2,4,8,9	39	-	S6LSC-21	10-500516-3	S6LSC-21	10-500516-3	5/8-24	10-821672-13
E-225-2,4,8,9	40	-	S6LSC-21	10-500516-10	S6LSC-21	10-500516-10	5/8-24	10-821672-13
IO-240A	-	-	S4LSC-21	10-500514-1	S4LSC-21	10-500514-1	3/4-20	10-821474-7
O-240A,D	-	10-400452	S4LSC-21	10-500514-1	S4LSC-21	10-500514-1	5/8-24	10-821471-1
O-240A,D	2	-	4300	-	4300	-	5/8-24	10-821401-1
GO-300A,B,C,D,E,F	-	-	S6RSC-21	10-500516-6	S6RSC-21	10-500516-6	5/8-24	10-821672-15
O-300A,B,C,D,E	-	10-400455	S6LSC-21	10-500516-4	S6LSC-21	10-500516-4	5/8-24	10-821672-9
O-300A,B,C,D,E	-	-	S6LSC-200	10-600616-6	S6LSC-204	10-600646-3	5/8-24	10-821672-9
O-300A,B,C,D,E	2	-	6300	-	6300	-	5/8-24	10-821601-9
IO-346A,B	-	-	S4LSC-201	10-600604-1	S4LSC-205	10-600654-1	3/4-20	10-821474-5
IO-360A	-	10-400475	S6LSC-25	10-500556-3	S6LSC-25	10-500556-3	3/4-20	10-821674-3
IO-360C	-	10-400475	S6LSC-25	10-500556-3	S6LSC-25	10-500556-3	3/4-20	10-821674-3
IO-360C	3	-	S6LSC-25	10-500556-3	S6LSC-25T	10-500556-203	3/4-20	10-821674-3
IO-360CB	-	10-400475	S6LSC-25	10-500556-3	S6LSC-25	10-500556-3	3/4-20	10-821674-3
IO-360CB	3	-	S6LSC-25	10-500556-3	S6LSC-25T	10-500556-203	3/4-20	10-821674-3
IO-360D	-	10-400475	S6LSC-25	10-500556-3	S6LSC-25	10-500556-3	3/4-20	10-821674-3
IO-360D	3	-	S6LSC-25	10-500556-3	S6LSC-25T	10-500556-203	3/4-20	10-821674-3
IO-360DB	-	10-400475	S6LSC-25	10-500556-3	S6LSC-25	10-500556-3	3/4-20	10-821674-3
IO-360ES	-	10-400475	S6LSC-25	10-500556-3	S6LSC-25	10-500556-3	3/4-20	10-821674-3

670

order on-line at
www.aviall.com

AVIALL
Aviation Parts Global Distribution

in North America
Call 1-800-AVIAL-1
(1-800-284-2551)

TEXTRON CONTINENTAL 4-CYLINDER ENGINES

UNISON

Application Data

Engine	Model	Magneto Mfr.	Plug Size	LH Magneto	RH Magneto	Harness	LH Harness	RH Harness	Non IC-Kit	Dual IC-RB Kit	Ref
A-65	1	SLICK SLICK	5/8 5/8	4333 4302	4333 4302	M2045 M2045	M1960 M1960	M1970 M1970	- K4522	K4334 -	A20 A16
A-65	3	SLICK SLICK SLICK SLICK	5/8 5/8 5/8 5/8	4333 4330 4302 4230	4333 4333 4302 4230	M2045 M2045 M2045 M2045	M1960 M1960 M1960 M1960	M1970 M1970 M1970 M1970	- - K4522 -	K4334 K4521-x - K4521-x	A20 A6 A16 A6
A-65	6	SLICK SLICK SLICK SLICK	5/8 5/8 5/8 5/8	4333 4330 4302 4230	4333 4330 4302 4230	M2045 M2045 M2045 M2045	M1960 M1960 M1960 M1960	M1970 M1970 M1970 M1970	- - K4522 -	K4334 K4521-x - K4521-x	A20 A6 A16 A6
A-65	6J	SLICK SLICK	5/8 5/8	4333 4302	4333 4302	M2045 M2045	M1960 M1960	M1970 M1970	- K4522	K4334 -	A20 A16
A-65	7	SLICK SLICK	5/8 5/8	4333 4302	4333 4302	M2045 M2045	M1960 M1960	M1970 M1970	- K4522	K4334 -	A20 A16
A-65	8	SLICK SLICK SLICK SLICK TCM/Bendix	5/8 5/8 5/8 5/8 5/8	4333 4330 4302 4230 S4-20; S4-200	4333 4330 4302 4230 S4-20; S4-200	M2045 M2045 M2045 M2045 M2351	M1960 M1960 M1960 M1960 M2353	M1970 M1970 M1970 M1970 M2352	- - K4522 -	K4334 K4521-x - K4521-x -	A20 A6 A16 A6 A
A-65	8F	SLICK SLICK	5/8 5/8	4333 4302	4333 4302	M2045 M2045	M1960 M1960	M1970 M1970	- K4522	K4334 -	A20 A16
A-65	8FJ	SLICK SLICK	5/8 5/8	4333 4302	4333 4302	M2045 M2045	M1960 M1960	M1970 M1970	- K4522	K4334 -	A20 A16
A-65	8J	SLICK SLICK	5/8 5/8	4333 4302	4333 4302	M2045 M2045	M1960 M1960	M1970 M1970	- K4522	K4334 -	A20 A16
A-75	3	SLICK SLICK	5/8 5/8	4333 4302	4333 4302	M2045 M2045	M1960 M1960	M1970 M1970	- K4522	K4334 -	A20 A16
A-75	6	SLICK SLICK	5/8 5/8	4333 4302	4333 4302	M2045 M2045	M1960 M1960	M1970 M1970	- K4522	K4334 -	A20 A16
A-75	6J	SLICK SLICK	5/8 5/8	4333 4302	4333 4302	M2045 M2045	M1960 M1960	M1970 M1970	- K4522	K4334 -	A20 A13
A-75	8	SLICK SLICK SLICK SLICK	5/8 5/8 5/8 5/8	4333 4330 4302 4230	4333 4330 4302 4230	M2045 M2045 M2045 M2045	M1960 M1960 M1960 M1960	M1970 M1970 M1970 M1970	- - K4522 -	K4334 K4521-x - K4521-x	A20 A6 A16 A6
A-75	8F	SLICK SLICK	5/8 5/8	4333 4302	4333 4302	M2045 M2045	M1960 M1960	M1970 M1970	- K4522	K4334 -	A20 A13
A-75	8FJ	SLICK SLICK	5/8 5/8	4333 4302	4333 4302	M2045 M2045	M1960 M1960	M1970 M1970	- K4522	K4334 -	A20 A13
A-75	8J	SLICK SLICK	5/8 5/8	4333 4302	4333 4302	M2045 M2045	M1960 M1960	M1970 M1970	- K4522	K4334 -	A20 A13
A-75	9	SLICK	5/8	4302	4302	M2045	M1960	M1970	K4522	-	A13
A-75	9J	SLICK	5/8	4302	4302	M2045	M1960	M1970	K4522	-	A13
C-75	8	SLICK SLICK SLICK TCM/Bendix	5/8 5/8 5/8 5/8	4333 4330 4230 S4-20; S4-200	4333 4330 4230 S4-20; S4-200	M2045 M2045 M2045 M2351	M1960 M1960 M1960 M2353	M1970 M1970 M1970 M2352	- - - -	K4334 K4521-x K4521-x -	A20 A6 A6 A
C-75	8F	SLICK	5/8	4333	4333	M2045	M1960	M1970	-	K4334	A
C-75	8FH	SLICK	5/8	4333	4333	M2045	M1960	M1970	-	K4334	A
C-75	8FHJ	SLICK	5/8	4333	4333	M2045	M1960	M1970	-	K4334	A
C-75	8FJ	SLICK	5/8	4333	4333	M2045	M1960	M1970	-	K4334	A

UNISON IGNITION

in North America

Call 1-800-AVIAL-1
(1-800-284-2551)**AVIAL**
Aviation International
Global Distribution

order on-line at

www.aviall.com

817

Aircraft Magneto Service

Continental A-65/ C-85 Bendix S-20 Magnetos

Home
Robinson R22/ R44
Slick
Bendix/ TCM S-20, 200,
1200
Distributor Gear
Maintenance
"Is It The Mag?"
Bendix/ TCM D-2000/D-
3000/D-3200,
Cessna Skymaster/
Mooney/Piper Seneca
Cessna C-210/ T-210
Continental A-65/ C-85
Ignition Vibrator
STC Pressurization Kits
Our Services
Contact Us

Bendix


S4RN-21 10-51360-28 **\$1000.00** EXCHANGE

\$1250.00 OUTRIGHT

S4RN-20 10-51360-27 **\$850.00** EXCHANGE

\$1100.00 OUTRIGHT

****EXCHANGE WITH ACCEPTABLE CORE****

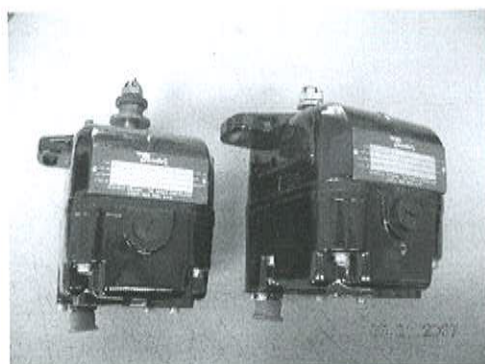

500 Hour Inspection
Overhaul
Repair

(Flat Rate) **\$300.00+** PARTS

(Flat Rate) **\$350.00+** PARTS

(Hourly Rate) **\$100.00+** PARTS

SF and SB Series Magnetos

Due to the difficulties in obtaining new parts for these Magnetos, we no longer service/ support the "Mailbox Style" Magneto. We can advise you as to a few companies who specialize in the SF/ SB Magneto.

Please call us for details.

206-219-0077 in WA.